

Customer:	Email:	Date: 12-11-04
Address:	Phone (h):	County: Hennepin
City/State/Zip: Edina/MN/55435	Phone (c):	Hudson:

PROBLEM

Lack of roof pitch combined with screw holes in rubber portion of roof from faulty gutter installation caused water damage to roof sheathing and fiberboard.



Customer:	Email:	Date: 12-11-04
Address:	Phone (h):	County: Hennepin
City/State/Zip: Edina/MN/55435	Phone (c):	Hudson:

SOLUTION

Rebuilt the damaged portion of the roof with 1/2" green treated decking, water resistant high density fiberboard, GRACE ultra ice & water shield, 60 mil rubber membrane and 4" drip edging with P & L flashing. Re-installed the gutters on outside fascia to prevent penetration through rubber portion of roof.

